



Melt Bolt Thermocouples

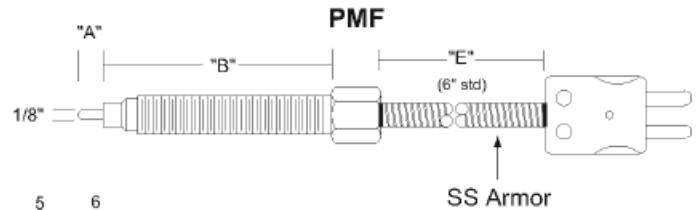

- Extruder Heads
- Die Adapters
- Tip goes directly into plastic melt

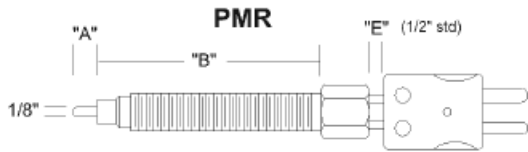

1 2 3 4 5 6
PMF JG 4 03 6 F

1. Style

PMF = Flexible style
PMR = Rigid style

2. TC Type

Grounded	
JG	= Type J
KG	= Type K
EG	= Type E
TG	= Type T
Ungrounded	
JU	= Type J
KU	= Type K
EU	= Type E
TU	= Type T

3. Tip Length (A)

4 = 1/4" (std.)
8 = 1/8"
F = flush
2 = 1/2"
3 = 3/4"
1 = 1"

6. Termination

For Rigid Type	
F	= Std. size Male Plug (std.)
G	= Std size Female Jack
For Flex type	
F	= Std. size Male Plug (std.)
G	= Std size Female Jack
C	= Male Mini Plug
D	= Female Mini Jack

5. (E) Dim

For Flex Style (F)	
6	= 6" (std.)
12	= 12"
specify other	
For Rigid Style (R)	
2	= 1/2" (std.)
specify other	

4. Bolt Length (B)

03 = 3"
04 = 4"
06 = 6"
08 = 8"
12 = 12"